


CORNER RECORD

Document Number 070-233-20

City of Greenbrae County of Marin, California

Brief Legal Description Lot 832 of 8 RM 29

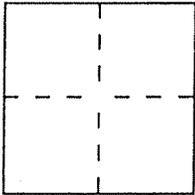

CORNER TYPE

Government Corner Control
Meander Property
Rancho Other
Date of Survey _____

COORDINATES
(Optional)

N. _____
E. _____
Zone _____ Datum _____
Elev. _____

Corner — Left as found Found and tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:

Found Standard Street monuments per 8 RM 29

A description of the physical condition of the monument as found and as set or reset:

Found existing corners (bars L.S. 5290) and set 1/2" bars
L.S. 5290 line stakes (over) as shown on the attached
"Sketch Map". Points were set in July 1996 and May 2008
(see map).

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyors' Act on May 30, 2008

Signed David Harp L.S. or R.C.E. Number LS 5290



COUNTY SURVEYOR'S STATEMENT


This Corner Record was received JUNE 2, 2008 and examined

and filed JUNE 18, 2008

Signed _____ Title COUNTY SURVEYOR



County Surveyor's Comment _____

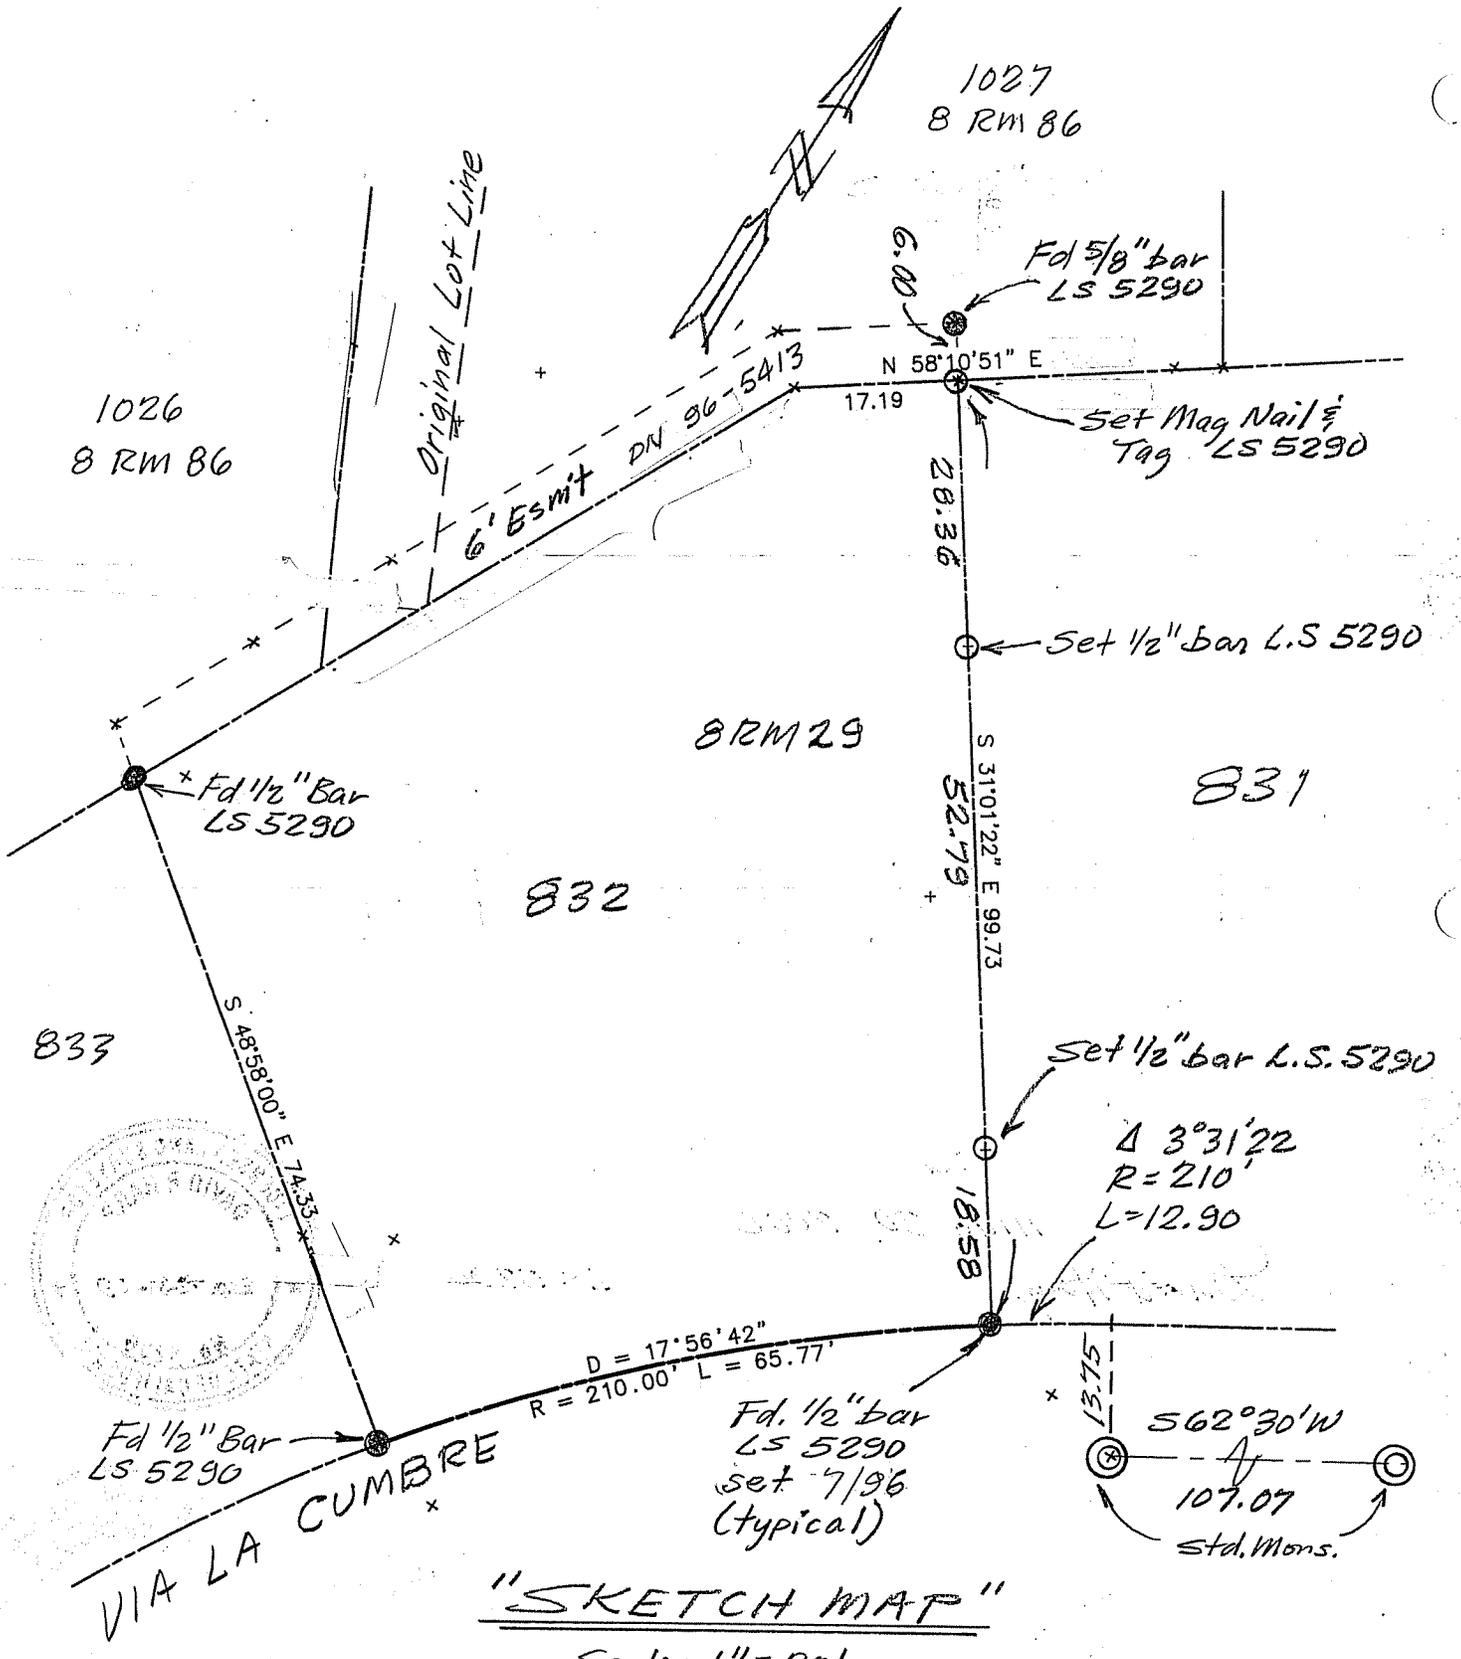

1027
8 RM 86

1026
8 RM 86

Original Lot Line
6' Esmit DN 96-5413

8 RM 29

832

833

831



Fd 1/2" Bar
LS 5290

VIA LA CUMBRE

Fd 1/2" bar
LS 5290
set 7/96
(typical)

"SKETCH MAP"

Scale: 1" = 20'

Fd 5/8" bar
LS 5290

N 58°10'51" E

Set Mag Nail &
Tag LS 5290

28.36

Set 1/2" bar L.S. 5290

S 31°01'22" E 99.73

52.79

Set 1/2" bar L.S. 5290

Δ 3°31'22"
R = 210'
L = 12.90

18.58

D = 17°56'42"
R = 210.00' L = 65.77'

13.75

S 62°30' W

107.07

Std. Mens.